


Zubehör Digitalanzeige
 ► PRÄZISIONSMASSTÄBE



PRÄZISIONSMASSTAB ARTIKEL

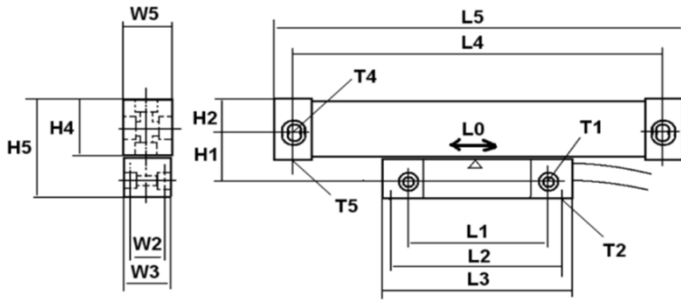

| S | ARTIKEL |
|--------|----------|
| 50 mm | 51000290 |
| 100 mm | 51000300 |
| 150 mm | 51000310 |
| 200 mm | 51000320 |

| | S | M | L |
|----|----------|----------|----------|
| L1 | 56 | 60 | 60 |
| L2 | - | 68 | 60 |
| L3 | 70 | 76 | 90 |
| L4 | L0 + 102 | L0 + 114 | L0 + 142 |
| L5 | L0 + 112 | L0 + 128 | L0 + 162 |
| H1 | 25,2 | 30 | 31,5 |
| H2 | 10 | 16 | 27 |
| H4 | 20 | 31,5 | 50 |
| H5 | 43 | 52,5 | 80,5 |
| W3 | 14 | 22 | 37 |
| W5 | 18 | 23,5 | 38 |
| T1 | M5 / ø 4 | M6 / ø 5 | M6 / ø 5 |
| T2 | - | M4 | M5 (4x) |
| T4 | ø 5 | ø 6 | ø 7 |
| T5 | ø 5 | ø 6 | ø 7 |



| M | ARTIKEL |
|--------|----------|
| 100 mm | 51000301 |
| 150 mm | 51000311 |
| 200 mm | 51000321 |
| 250 mm | 51000330 |
| 300 mm | 51000340 |
| 350 mm | 51000350 |
| 400 mm | 51000360 |
| 450 mm | 51000370 |
| 500 mm | 51000380 |
| 550 mm | 51000390 |
| 600 mm | 51000400 |
| 650 mm | 51000410 |
| 700 mm | 51000420 |
| 750 mm | 51000430 |
| 800 mm | 51000440 |
| 850 mm | 51000450 |
| 900 mm | 51000460 |



| L | ARTIKEL |
|---------|----------|
| 750 mm | 51000431 |
| 950 mm | 51000470 |
| 1000 mm | 51000480 |
| 1100 mm | 51000490 |
| 1200 mm | 51000500 |
| 1400 mm | 51000520 |
| 1500 mm | 51000530 |
| 1600 mm | 51000540 |
| 1900 mm | 51000570 |
| 2000 mm | 51000580 |
| 2100 mm | 51000590 |
| 3000 mm | 51000640 |